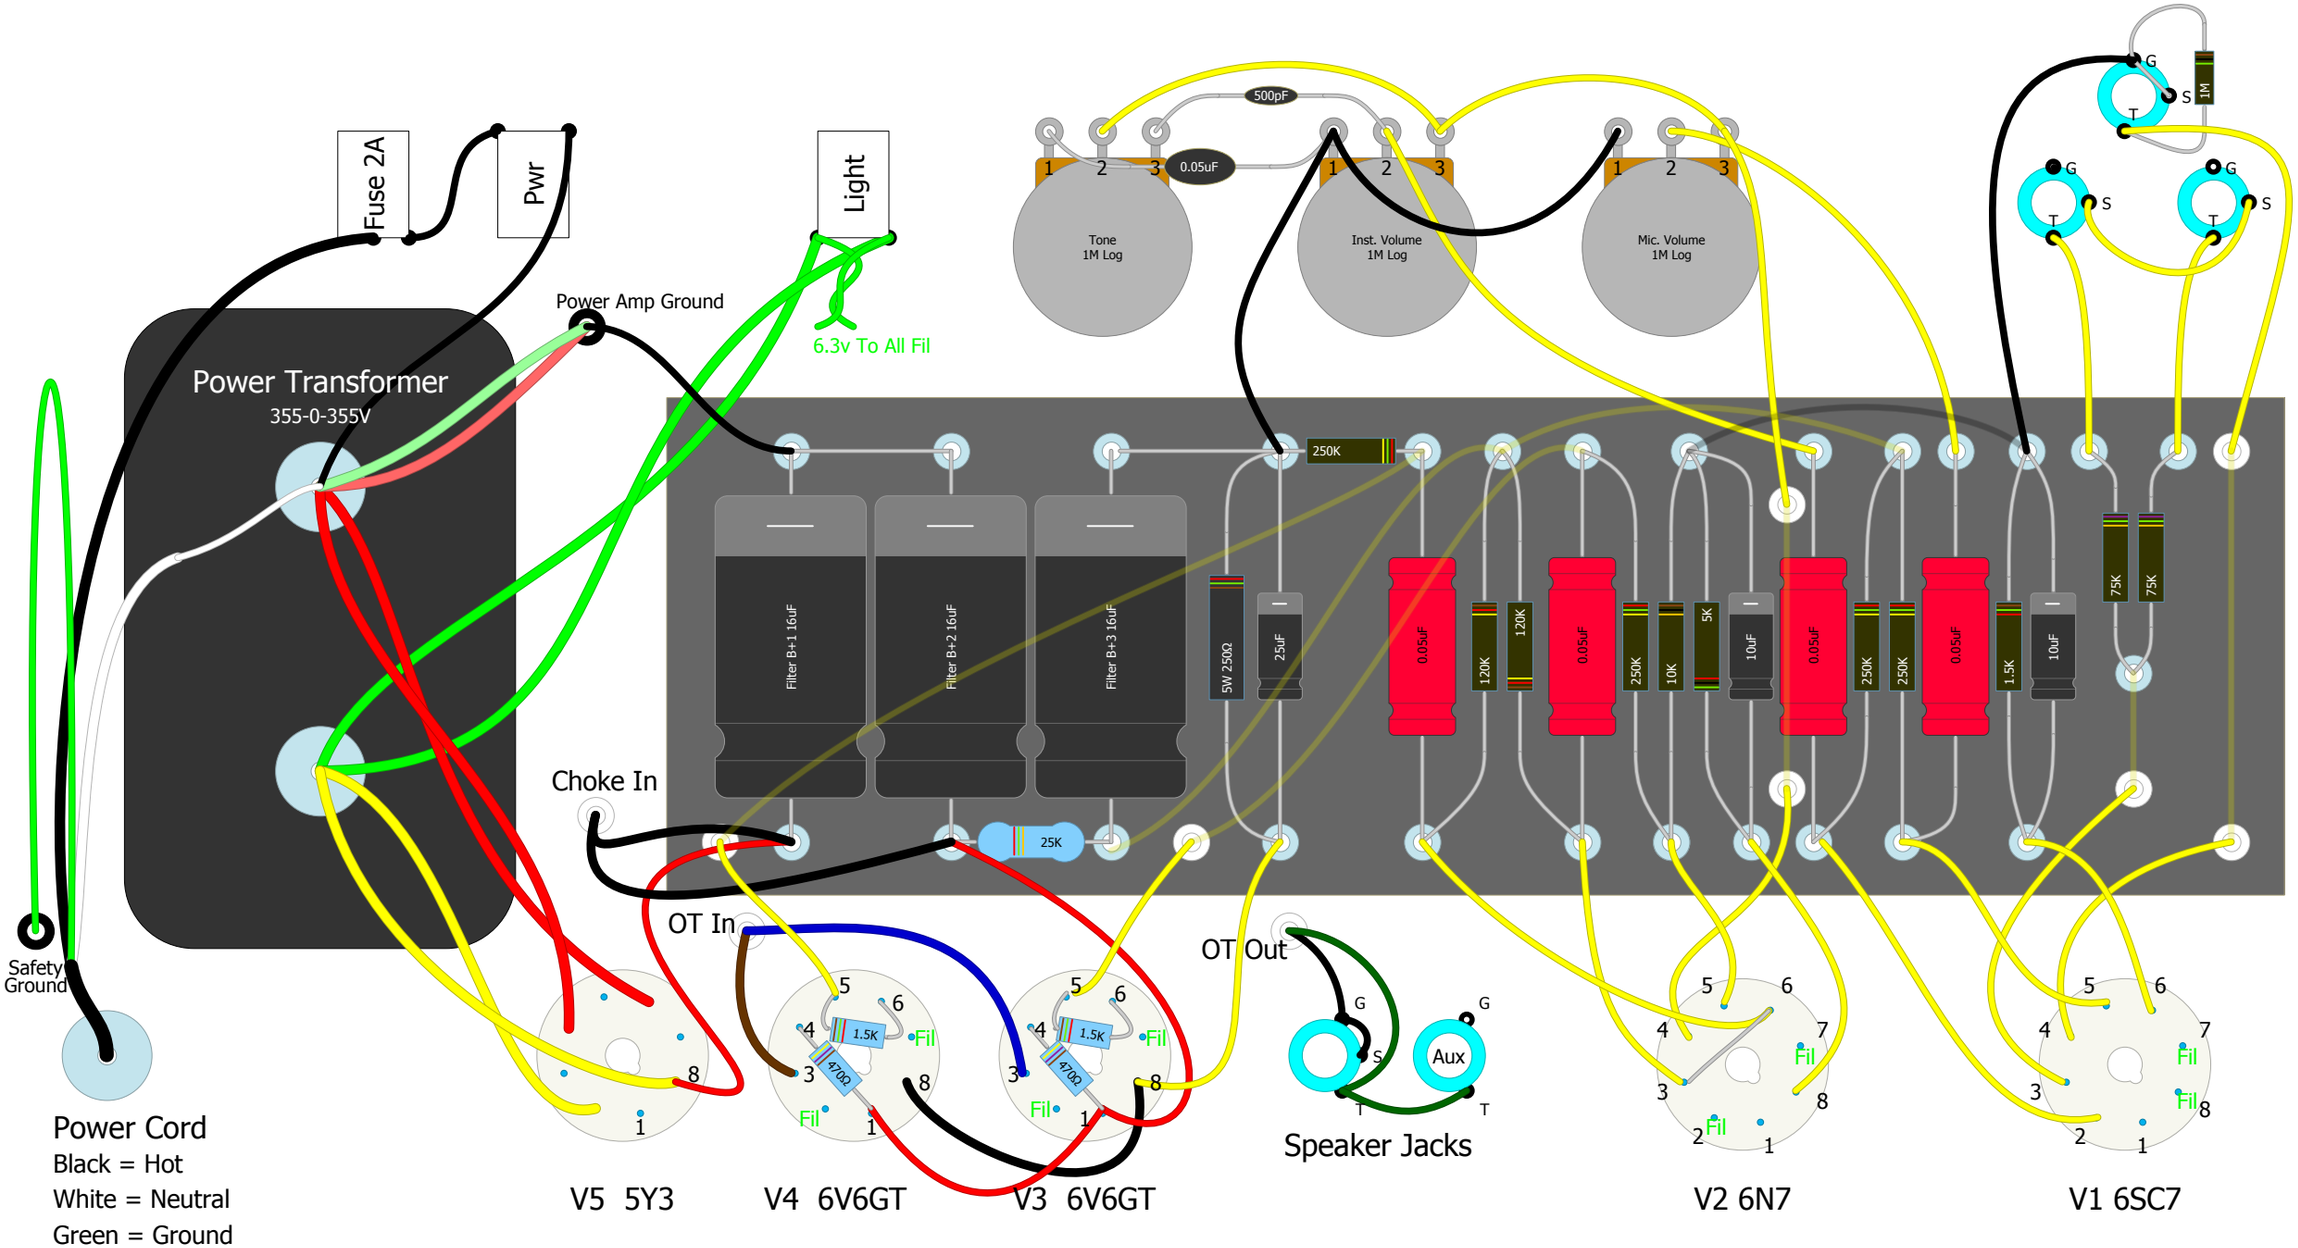
Fuse 2A
Pwr
Light
Power Amp Ground
6.3v To All Fil
Power Transformer
355-0-355V
500pF
0.05uF
Tone
1M Log
Inst. Volume
1M Log
Mic. Volume
1M Log
1M
250K
Filter B+1 16uF
Filter B+2 16uF
Filter B+3 16uF
5W 250Ω
25uF
0.05uF
120K
120K
0.05uF
250K
10K
5K
10uF
0.05uF
250K
250K
0.05uF
1.5K
10uF
75K
75K
25K
Choke In
OT In
OT Out
Safety Ground
Power Cord
Black = Hot
White = Neutral
Green = Ground
1.5K
470Ω
Fil
Aux
Speaker Jacks
V5 5Y3
V4 6V6GT
V3 6V6GT
V2 6N7
V1 6SC7