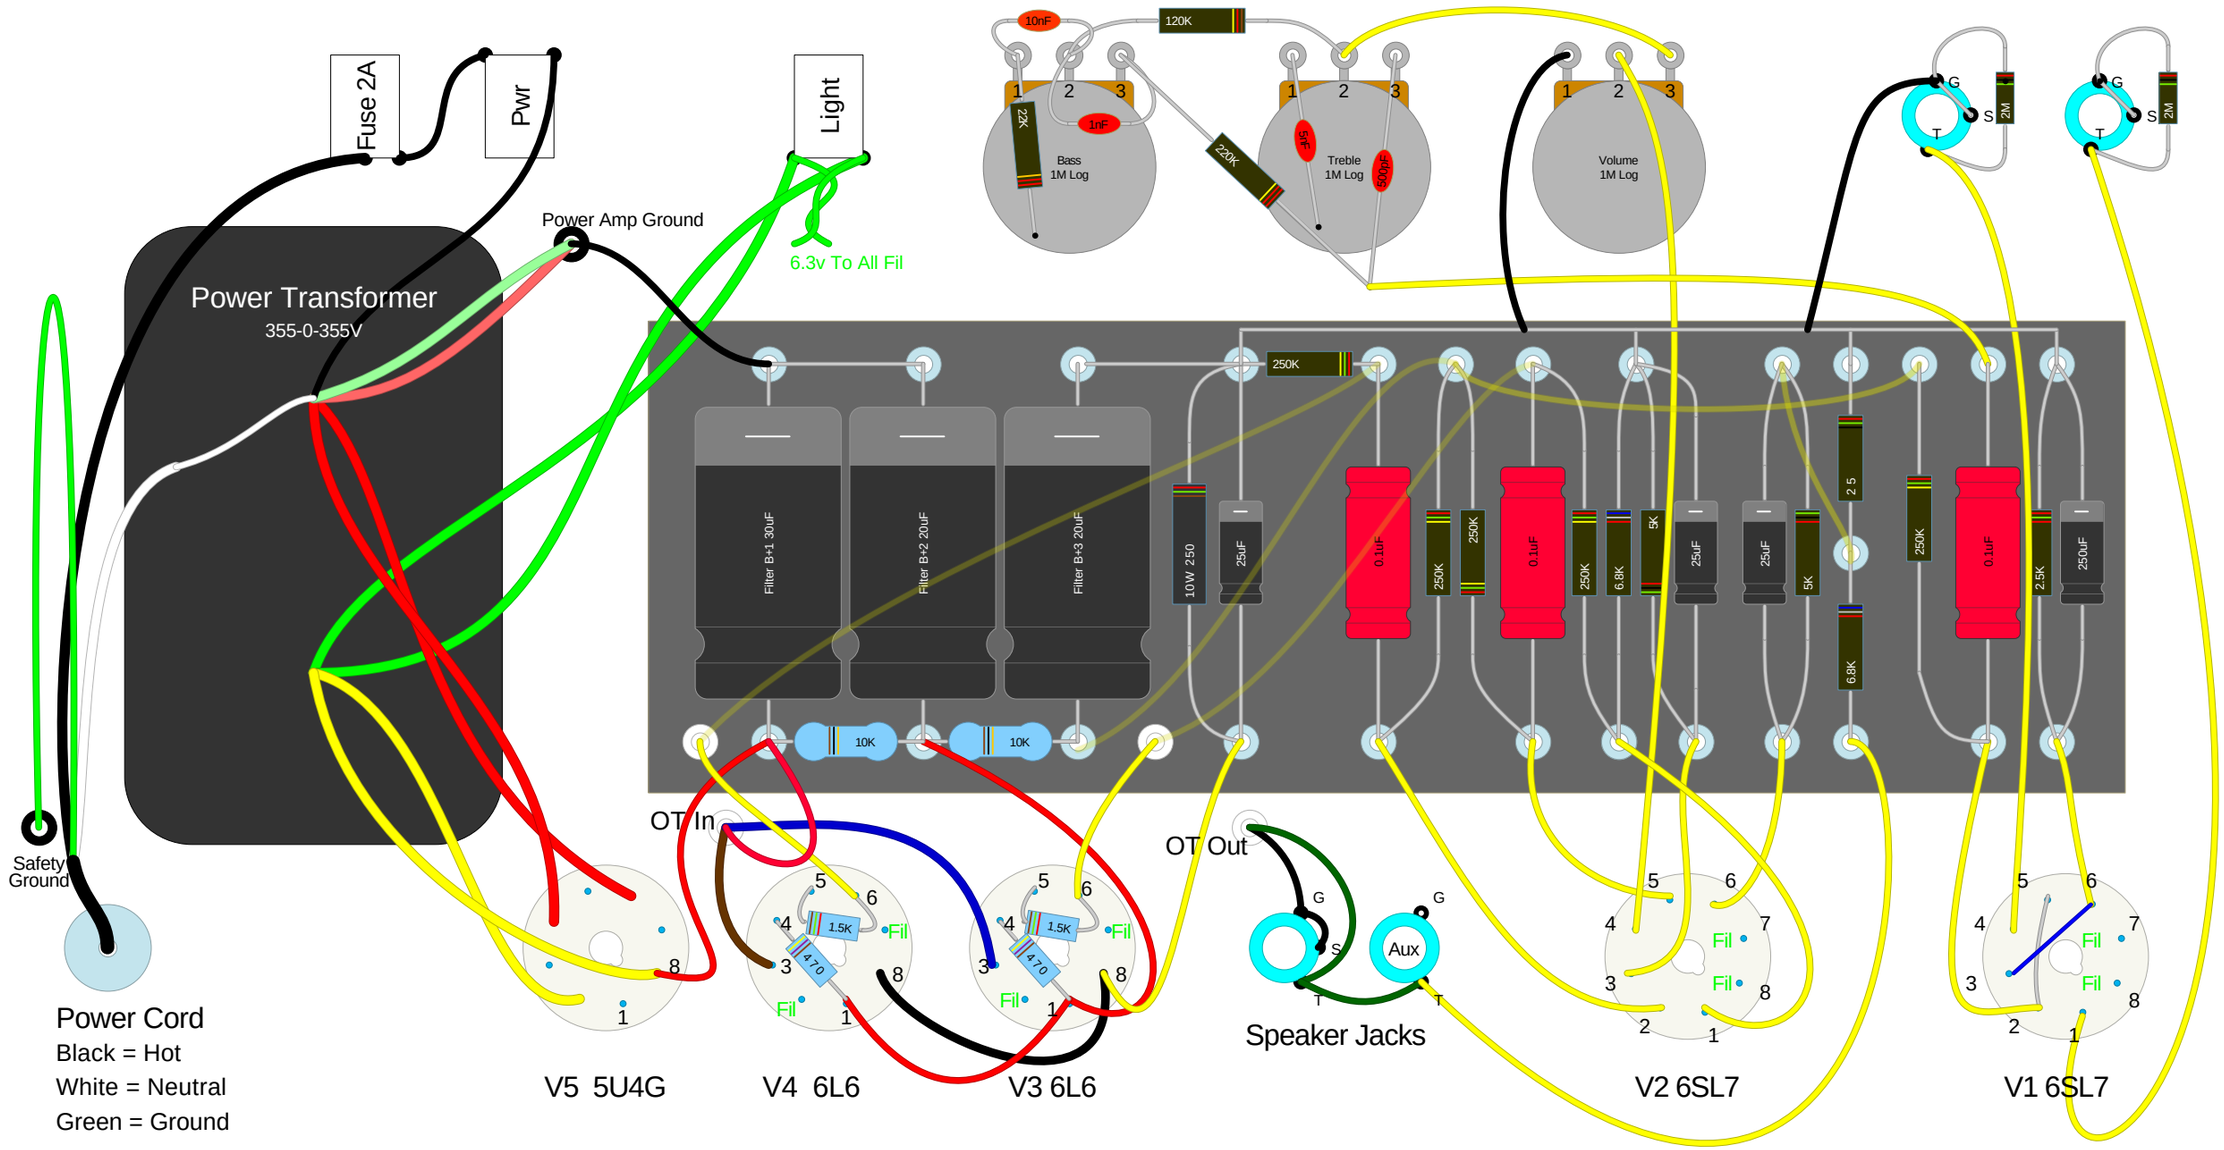
Fuse 2A
Pwr
Light
6.3v To All Fil
Power Amp Ground
Power Transformer
355-0-355V
Safety Ground
Power Cord
Black = Hot
White = Neutral
Green = Ground
10nF
120K
1nF
22K
Bass
1M Log
220K
4nF
500pF
Treble
1M Log
Volume
1M Log
2M
Filter B+1 30uF
Filter B+2 20uF
Filter B+3 20uF
10K
10W 250
25uF
250K
0.1uF
6.8K
5K
2.5
2.5K
250uF
OT In
OT Out
1.5K
470
Fil
Aux
Speaker Jacks
V5 5U4G
V4 6L6
V3 6L6
V2 6SL7
V1 6SL7